

Hazardous Building Materials Assessment Cecily Street Community Centre 19 Cecily Street, Lilyfield NSW 2040

Inner West Council
April 2018

Client No.: S0149

Client: Inner West Council

Job No.: 57722-027

Count ID: CID: 242



Executive Summary

Introduction

Prensa Pty Ltd (Prensa) was engaged by Inner West Council (IWC) to conduct a Hazardous Building Materials Assessment (Assessment) of Cecily Street Community Centre located at 19 Cecily Street, Lilyfield NSW 2040 (the site). Ellen Hibbert and Dylan Handley of Prensa conducted the Assessment on 2nd February 2018 at the request of Rick Jarvis of IWC.

The objective of this Assessment was to identify and assess the health risk posed by hazardous building materials which are considered accessible during normal occupation of the building.

Scope of Works

The scope of the Assessment included the interior and exterior of Cecily Street Community Centre located at 19 Cecily Street, Lilyfield NSW 2040.

Specifically, Prensa included the following hazardous building materials in the scope of this Assessment:

- Asbestos-containing materials (ACM); and

Other Hazardous Materials (OHMs) inclusive of:

- Synthetic mineral fibre (SMF) materials;
- Polychlorinated biphenyls (PCB) containing capacitors in electrical fittings;
- Lead-containing paint (LCP); and
- Ozone depleting substances (ODS).

Methodology

The Assessment comprised a review of available information, interviews with available site personnel and a visual inspection of reasonably accessible areas. The Assessment was conducted in accordance with the current NSW Work Health and Safety Act 2011 and Regulation 2017.

Site Description

The site consists of a single building. Details of the building contained within this site are provided in **Table 1** below.

Table 1: Site Information			
Site:	CID: 242 – Cecily Street Community Centre, 19 Cecily Street, Lilyfield NSW 2040		
Age (Circa):	1970's	External walls:	Brick
Approximate area:	400 m ²	Internal walls:	Concrete and plasterboard
Levels:	1	Ceiling:	Plasterboard
Roof type:	Corrugated metal	Floor and coverings:	Sheet vinyl, carpet and timber

Asbestos Risk Profile

The following table gives a summary of the Hazardous Building Materials identified or suspected during the Assessment:

Site Name	Number of items			OHM Requires Remediation
	ACM			
	High	Medium	Low	
Cecily Street Community Centre	0	0	5	0

Table of Contents

1. Hazardous Building Materials Register	1
2. Photographs	2
3. Site Plan.....	6
4. Findings	7
5. Methodology.....	9
6. Management Options	10
7. Accidental Disturbance of Known or Suspected Hazardous Building Materials.....	10
8. Site Specific Recommendations	11
Appendix A: Risk Assessment Factors and Priority Ratings	13
Appendix B: Areas Not Accessed.....	17
Appendix C: NATA Endorsed Laboratory Sample Analysis Report	19
Appendix D: Statement of Limitations	20

1. Hazardous Building Materials Register

Key to hazardous building materials priority risk rating:	
ACM Priority 1 (P1):	High Priority – Requiring immediate action
ACM Priority 2 (P2):	Medium Priority – May require action in the short term (12 months)
ACM Priority 3 (P3):	Low Priority – May require action in the medium term (3 years)
ACM Priority 4 (P4):	Very Low Priority – Requires ongoing management or longer term remedial action (5 years)
OHM Action Required	All Other Hazardous Materials that require remediation in the short term.

Important Note:

Priority Ratings listed above are only applicable to hazardous materials that require remediation. Where there is no remediation necessary, hazardous materials should be re-inspected in accordance with the dates listed in the register (typically 5 yearly for ACM in good condition).

Client: Inner West Council

Site Name: CID: 242 - Cecily Street Community Care

Site Address: 19 Cecily Street, Lilyfield NSW 2040

Client No.: S0149

Job No.: 57722-027

Area / Level	Room & Location	Feature	Item Description	Hazard Type	Sample No.	Sample Status	Friability	Disturb. Potential	Condition	Risk Status	Approx. Quantity	Recommendations & Comments	Control Priority	Reinspect Date	Photo No.
Exterior	Throughout	Roof	Corrugated cement sheeting	Asbestos	Refer to EBG report HMA-01998.rpt. 01998/4	Assumed Positive	Non-friable	Unknown	Unknown	Unknown	200 m ²	Item not located during PRENSA Assessment. Sample noted to be positive for asbestos content by GETEX report HMA-01998.rpt. Suspected to have been removed during renovations works. No clearance certificate provided. Investigate further if to impacted upon by works.	P4	Feb-23	-
Exterior	Throughout	Guttering	Moulded fibre cement	Asbestos	Refer to EBG report HMA-01998.rpt	Suspected Positive	Non-friable	Unknown	Unknown	Unknown	30 m	Item not located during PRENSA Assessment. Sample noted to be positive for asbestos content by GETEX report HMA-01998.rpt. Suspected to have been removed during renovations works. No clearance certificate provided. Investigate further if to impacted upon by works.	P4	Feb-23	-
Exterior	Throughout	Flash guards	Moulded fibre cement	Asbestos	Refer to EBG report HMA-01998.rpt. 01998/5	Assumed Positive	Non-friable	Unknown	Unknown	Unknown	15 m	Item not located during PRENSA Assessment. Sample noted to be positive for asbestos content by GETEX report HMA-01998.rpt. Suspected to have been removed during renovations works. No clearance certificate provided. Investigate further if to impacted upon by works.	P4	Feb-23	-
Exterior	Throughout	Guttering	Debris	Asbestos	Refer to EBG report HMA-01998.rpt. 01998/7	Assumed Positive	Non-friable	Unknown	Unknown	Unknown	1 m ²	Item not located during PRENSA Assessment. Sample noted to be positive for asbestos content by GETEX report HMA-01998.rpt. Suspected to have been removed during renovations works. No clearance certificate provided. Investigate further if to impacted upon by works.	P4	Feb-23	-
Exterior	North-east elevation, kids play area	Awning	Fibre cement sheeting	Asbestos	Not sampled: Timber	Negative	-	-	-	-	-	Material made of masonite	-	-	-
Exterior	North-east corner	Electrical backing board	Bituminous backing board	Asbestos	Not sampled: Electrical hazard	Suspected Positive	Non-friable	Low	Good	Low	1 unit	Confirm status, label as containing asbestos and maintain in current condition if to remain in-situ. Remove under controlled non-friable asbestos removal conditions prior to refurbishment or demolition works by a Class B (non-friable) licensed asbestos removal contractor.	P4	Feb-23	1
Exterior	North corner	Eaves	Fibre cement sheeting	Asbestos	57722-027-001	Negative	-	-	-	-	-	-	-	-	2
Interior	North store room, throughout	Walls - internal	Fibre cement sheeting	Asbestos	57722-027-002	Negative	-	-	-	-	-	-	-	-	3
Interior	North store room, throughout	Ceiling	Fibre cement sheeting	Asbestos	Not sampled: Timber	Negative	-	-	-	-	-	Material made of masonite	-	-	-
Interior	Meeting room	Floor coverings - blue (light)	Sheet vinyl	Asbestos	57722-027-003A	Negative	-	-	-	-	-	-	-	-	4
Interior	Meeting room	Adhesive attached to sample 57722-027-003A	Adhesive	Asbestos	57722-027-003B	Negative	-	-	-	-	-	-	-	-	-
Interior	Quiet room, southern wall	Walls - internal	Fibre cement sheeting	Asbestos	57722-027-004	Negative	-	-	-	-	-	-	-	-	5
Interior	Quiet room, throughout	Floor coverings - red	Sheet vinyl	Asbestos	57722-027-005	Negative	-	-	-	-	-	-	-	-	6

Area / Level	Room & Location	Feature	Item Description	Hazard Type	Sample No.	Sample Status	Friability	Disturb. Potential	Condition	Risk Status	Approx. Quantity	Recommendations & Comments	Control Priority	Reinspect Date	Photo No.
Interior	Quiet room, throughout	Adhesive attached to sample 57722-027-005A	Adhesive	Asbestos	57722-027-005B	Negative	-	-	-	-	-	-	-	-	-
Interior	Kitchen	Floor coverings - cream	Sheet vinyl	Asbestos	Not sampled: Modern appearance	Suspected Negative	-	-	-	-	-	Suspected negative due to age and appearance.	-	-	-
Interior	Hall, stage	Floor coverings - cream	Sheet vinyl	Asbestos	57722-027-006A	Negative	-	-	-	-	-	-	-	-	7
Interior	Hall, stage	Adhesive attached to sample 57722-027-006A	Adhesive	Asbestos	57722-027-006B	Negative	-	-	-	-	-	-	-	-	-
Interior	Hall, eastern and northern elevations	Walls	Textured coatings	Asbestos	57722-027-007	Negative	-	-	-	-	-	-	-	-	8
Interior	Hall, south-eastern elevation	Fire door - double	Fire door core	Asbestos	Not sampled: Sealed unit	Suspected Negative	-	-	-	-	-	Suspected negative due to age and appearance.	-	-	-
Interior	Western store room	Floor coverings - blue (dark)	Sheet vinyl	Asbestos	57722-027-008A	Negative	-	-	-	-	-	-	-	-	9
Interior	Western store room	Adhesive attached to sample 57722-027-008A	Adhesive	Asbestos	57722-027-008B	Negative	-	-	-	-	-	-	-	-	-
Interior	Kitchen, east wall above sink	Hot water boiler	Insulation material - internal	SMF	-	Suspected Positive	Bonded	Low	Good	Low	1 unit	Maintain in current condition if to remain in-situ. Remove under controlled SMF conditions as per the Code of Practice for the Safe Use of Synthetic Mineral Fibres [NOHSC: 2006 (1990)].	-	-	10
Interior	Roof space, throughout	Insulation	Insulation batts	SMF	-	Suspected Positive	Bonded	Low	Good	Low	200 m ²	Maintain in current condition if to remain in-situ. Remove under controlled SMF conditions as per the Code of Practice for the Safe Use of Synthetic Mineral Fibres [NOHSC: 2006 (1990)].	-	-	11
Exterior	North-east elevation, to covered play area	Fluorescent light fitting - single tube	Capacitor	PCBs	Not sampled: Electrical hazard	Suspected Positive	-	-	-	-	6 units	PCB-containing capacitors are suspected due to age & appearance of electrical fittings. Remove and dispose of in accordance with the Polychlorinated Biphenyls Management Plan, Revised Edition April 2003.	-	-	12
Exterior	Throughout	Eaves	Cream - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	30 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	2
Exterior	Throughout	Decorative paint to eave skirting	Green (dark) - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	10 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	13
Exterior	Covered play area	Ceiling	Cream - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	55 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	-

Area / Level	Room & Location	Feature	Item Description	Hazard Type	Sample No.	Sample Status	Friability	Disturb. Potential	Condition	Risk Status	Approx. Quantity	Recommendations & Comments	Control Priority	Reinspect Date	Photo No.
Interior	Northern store room	Ceiling	Green (dark) - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	15 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	-
Interior	Meeting room	Ceiling	White - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	27 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	14
Interior	Meeting room	Walls - internal	Cream - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	40 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	14
Interior	Ceramics room	Walls - internal	Yellow (light) - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	42 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	15
Interior	Office	Walls - internal	Blue (light) - upper coloured paint system	Lead Paint - Swab	-	Suspected Positive	-	Low	Good	Low	35 m ²	Confirm status by quantitative test method, maintain in current condition, over paint with a lead-free paint as part of ongoing maintenance. Remove under controlled conditions in accordance with AS 4361.2:2017 Guide to hazardous paint management prior to renovation or demolition works.	-	-	-
Throughout	-	-	-	Ozone Depleting Substances	-	-	-	-	-	-	-	No suspect ODS's identified at the time of the assessment.	-	-	-
Roof space	-	-	-	-	-	-	-	-	-	-	-	Limited access at the time of the assessment.	-	-	-

2. Photographs




KEY	
	Confirmed or suspected ACM
	Confirmed or suspected other hazardous material type (SMF, PCB, LCP or ODS)
	Confirmed or suspected non-ACM or other non-hazardous material



Photo 1. Exterior, north-east elevation, electrical backing board – suspected asbestos-containing bituminous backing board.



Photo 2. Exterior, north corner, eaves – non asbestos-containing fibre cement sheeting and suspected lead-containing cream upper paint systems.



Photo 3. Interior, north store room, throughout, internal walls – non asbestos-containing fibre cement sheeting.



Photo 4. Interior, meeting room, light blue floor coverings – non asbestos-containing sheet vinyl.



Photo 5. Interior, quiet room, southern wall – non asbestos-containing fibre cement sheeting.



Photo 6. Interior, quiet room, throughout, red floor coverings – non asbestos-containing sheet vinyl.



Photo 7. Interior, hall stage, cream floor coverings – non asbestos-containing sheet vinyl.



Photo 8. Interior, hall, eastern and northern elevation, walls – non asbestos-containing textured coatings.



Photo 9. Interior, western store room, blue floor coverings – non asbestos-containing sheet vinyl.



Photo 10. Interior, kitchen, east wall, above sink, hot water boiler – suspected SMF internal insulation material.



Photo 11. Interior, roof space, throughout, insulation – suspected SMF insulation batts.



Photo 12. Exterior, north-east elevation, to covered play area, single tubed fluorescent light fittings – suspected PCB-containing capacitors.



Photo 13. Exterior, throughout, decorative skirting to eaves – suspected lead-containing dark green upper paint systems.



Photo 14. Interior, meeting room, ceiling and walls – suspected lead-containing white and cream upper coloured paint systems.




Photo 15. Interior, ceramics room, walls – suspected lead-containing light yellow upper paint systems.

3. Site Plan

Important Note:

*Only asbestos-containing materials (ACM) have been labelled on the attached site plan to prevent confusion and ensure that these materials are given priority for action. Therefore, other hazardous materials may be present within the building and the register attached in **Section 1** should be consulted prior to work commencing.*

Cecily Street Community Centre, Lilyfield - Ground Level

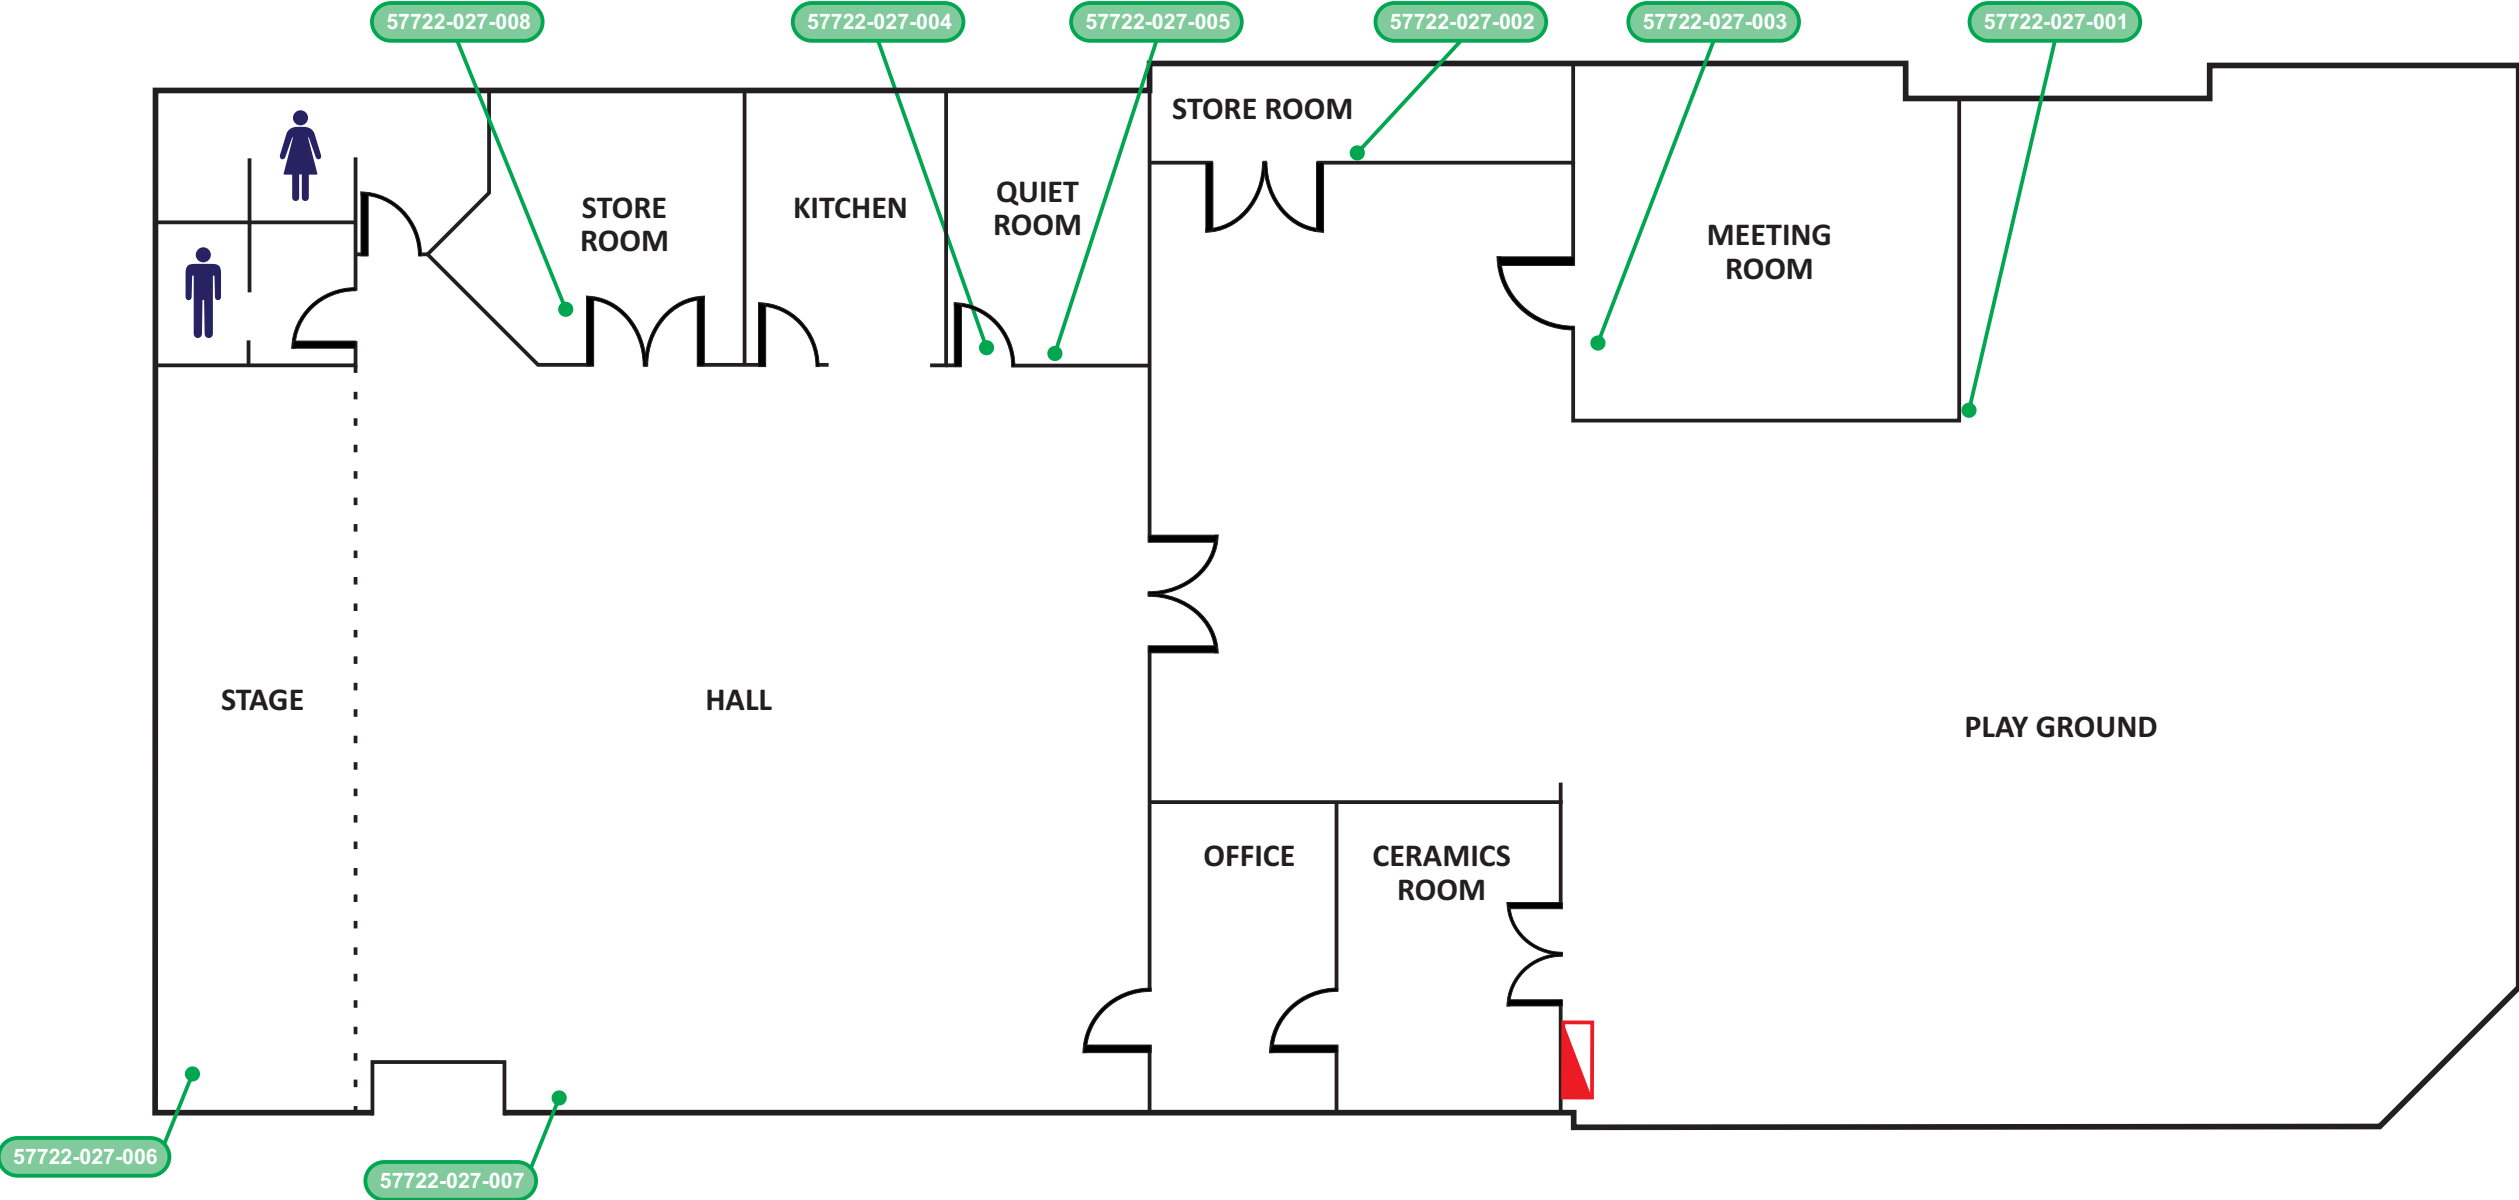

2/115 Military Rd,
Neutral Bay NSW 2089
admin@prensa.com.au

P: (02) 8968 2500
F: (02) 8968 2599
www.prensa.com.au

Client:	Inner West Council
Project:	Hazardous Building Materials Assessment
Address:	19 Cecily Street, Lilyfield NSW 2040
Drawing Title:	Cecily Street Community Centre
Job No.:	57722-027
Client No.:	S0149
IWC Code:	CID 242

Legend:

	Negative Asbestos Sample
	Electrical Board

<p>Note: All locations are approximate</p>	
<p>Drawn by: TME</p>	<p>Date: 15/05/2018</p>
<p>Checked by: MM</p>	<p>Date: 15/05/2018</p>
<p>Figure number: 1</p>	<p>Revision: 3</p>
<p>File name: 57722-027 - Rev 3</p>	

4. Findings

Document Review and Interviews

As part of this Assessment, Prensa requested copies of previous documentation pertaining to hazardous building materials at the site.

IWC made available to Prensa a previous survey report that had been carried out by EBG Environmental Geoscience, dated May 2010. The survey report (*Hazardous Material Audit – Lilyfield Community Centre, HMA-01998.rpt*) is understood to be the most recent survey report for this site.

The following key findings from the EBG report will be referenced in Prensa’s report:

- Asbestos-containing corrugated cement sheeting throughout the roof.
- Asbestos-containing moulded fibre cement located throughout guttering.
- Asbestos-containing moulded fibre cement located throughout the flashing on the roof.
- Asbestos-containing debris found in the gutters.

It should be noted these items were not located during the PRENSA Assessment, it is assumed that a renovation has taken place in between the time of the two reports. However, these areas should be treated as asbestos-containing until confirmation that these items have been removed entirely.

Reference has been made to the findings of this report and to the NATA accredited bulk sample analysis.

Asbestos Bulk Sample Analysis

A total of eight (8) samples suspected to contain asbestos were collected and submitted to Prensa’s NATA accredited laboratory for analysis. The asbestos bulk sample analysis report is provided in **Appendix C: NATA Endorsed Laboratory Sample Analysis Reports** of this Assessment report. In summary, zero (0) sample were reported to contain asbestos.

Assessment Findings

The findings of this Assessment are presented in tabulated format in **Section 1. Hazardous Building Materials Register** of this Assessment report. Hazardous building materials that have been photographed are depicted in **Sections 2. Photographs** of this Assessment report.

The following hazardous building materials were identified or suspected during the Assessment:

Property	Asbestos-containing Materials		Synthetic Mineral Fibre	Poly-chlorinated Biphenyls	Lead-containing Paint	Ozone Depleting Substances
	Non-friable	Friable				
Cecily Street Community Centre	✓	-	✓	✓	✓	-

The following significant key findings are noted:

Asbestos-containing Materials

- Non-friable asbestos in the form of bituminous backing board was suspected in the electrical backing board located to the north-east exterior of the building.
- No clearance paperwork is known to exist for the removal of ACMs noted in the EBG report. As such, an assumption must be made that the asbestos-containing roof, gutters and flashing remain *in-situ* until such a time as a clearance certificate can be produced to show material has been removed as per current standards.

Synthetic Mineral Fibre Materials

- SMF internal insulation material was suspected within the hot water boiler located in the kitchen.
- SMF insulation batts were suspected throughout the roof space.

Polychlorinated Biphenyls

- PCBs were suspected within the capacitors of the single tube fluorescent light fittings located to the exterior of the building.

Lead-containing Paint

- LCP was suspected in the form of cream and green upper coloured paint systems to the exterior of the building.
- LCP was suspected in the form of green, white, cream and yellow upper coloured paint systems throughout the interior of the building.

Ozone depleting substances

- No ODS-containing air conditioning units were identified or suspected during the Assessment.

Areas Not Accessed

Areas that are generally not accessed as part of Prensa's Assessments are listed in **Appendix B: Areas Not Accessed**. Site-specific areas that were inaccessible during Prensa's Assessments and were deemed likely to contain asbestos are also listed in **Appendix B: Areas Not Accessed** and **Sections 1. Hazardous Building Materials Register**.

5. Methodology

The Assessment comprised a review of relevant site information made available to Prensa, interviews with available site personnel and a visual inspection of accessible areas and destructive sampling techniques where necessary.

The methodology for assessing the hazardous building materials at the site is presented in the following sections.

Asbestos-containing Materials - This component of the Assessment was carried out in accordance with the guidelines documented in the relevant Codes of Practice. When safe to do so, building materials that were suspected of containing asbestos were sampled at the discretion of the Prensa consultant. Samples of suspected ACMs were analysed in Prensa's laboratory, which is NATA accredited to conduct asbestos bulk sample analysis. The analysis was conducted using polarised light microscopy including dispersion staining techniques.

Synthetic Mineral Fibres - This component of the Assessment was carried out in accordance with the guidelines documented in the *Code of Practice for the Safe Use of Synthetic Mineral Fibres* [NOHSC: 2006 (1990)]. This report broadly identifies SMF materials found or suspected of being present during the Assessment and is based on a visual Assessment.

Polychlorinated Biphenyls - Where safely accessible, specifications of capacitors incorporated in light fittings and ceiling fans were recorded and cross-referenced with the Australian and New Zealand Environment Conservation Council (ANZECC) *Identification of PCB-containing Capacitors information booklet* – 1997. Due to the danger of accessing electrical components, or for other reasons, such as height restrictions, some electrical fittings may not have been accessed. In these instances, comment is provided in the Assessment report on the likelihood of PCB-containing materials being present. This determination is based upon the age and appearance of the electrical fittings.

Lead-containing Paint - Representative painted surfaces were tested in locations for the presence of lead using the qualitative *LeadCheck* paint swab method. This method can detect lead in paint at concentrations of 0.5% and above, and may indicate lead in some paint films as low as 0.2%. It is noted that the former Australian Standard (AS) 4361.2 – 1998 *Guide to lead paint management – Part 2: Residential and commercial buildings* defined lead paint as paint with a lead content greater than 1% by dry weight. This standard was updated in December 2017 (*AS4361.2-2017 Guide to Hazardous Paint Management – Part 2 – Lead Paint in Residential, Public and Commercial Buildings*) and now defines lead paint as paint with a lead content greater than 0.1% by dry weight (i.e. 90% reduction in content from 1998 standard). It should be noted that paint manufactured since 1997 contains <0.1% lead by weight (i.e. considered non lead based paint).

In circumstances where a “positive” (lead present) test result is obtained from the *LeadCheck* swab, these paint situations have been recorded in the register as LCP. For surface coatings installed prior to 1997, where “negative” test results are obtained from the *LeadCheck* swab, these situations have been recorded as “suspected positive” for lead content in the hazardous materials register. Prensa recommend that quantitative testing is conducted prior to disturbance of these situations using a NATA accredited laboratory.

The sampling program attempts to be representative of the various types of paints found at the Site. However, particular attention is paid to areas where LCPs were more likely to have been used (e.g. exterior gloss paints, window and door architraves and skirting boards). The objective of LCP identification in this Assessment is to highlight the presence of LCP within the site building(s), not to specifically identify every location of LCP.

Ozone Depleting Substances – This component of the Assessment comprised a visual inspection of air conditioning units and any chillers (if applicable) at the site and included a review of the air conditioners’ refrigerant types.

6. Management Options

As per NSW legislation, all materials suspected of containing asbestos must be identified and recorded in a register. Furthermore, a risk Assessment must be conducted of each hazardous building material and appropriate control measures implemented. The control measures have been determined based on reducing the risk of exposure, so far as is reasonably practicable. The control measures, which were determined by a competent person and/or hygienist, need to reflect the hierarchy of control outlined in specific state legislation and is as follows:

1. **Elimination**/removal (most preferred);
2. **Substitution**;
3. **Isolation**, such as erection of permanent enclosures encasing the material;
4. **Engineering** controls, such as negative air pressure enclosures for removal works, HEPA filtration systems;
5. **Administrative** controls – including the incorporation of registers and management plans, the use of signage, personnel training, safe work procedures, regular re-inspections and registers; and
6. The use of **Personal Protective Equipment** (PPE) (least preferred).

To manage the hazardous building materials, a combination of the above techniques may be required.

7. Accidental Disturbance of Known or Suspected Hazardous Building Materials

In the unlikely event that there is an accidental disturbance of known or suspected hazardous building materials the following procedures should be implemented:

1. Cease work immediately during maintenance or refurbishment works.
2. Isolate and evacuate the affected area.
3. Close and lock doors to affected area and post signs “No Entry”.
4. Notify the Inner West Council immediately at maintain@innerwest.nsw.gov.au or via phone on (02) 9392 5389.

8. Site Specific Recommendations

Based on the findings of this Assessment, it is recommended that the following control measures be adopted as part of the management of the hazardous building materials at the Site. Recommendations for specific items of hazardous building materials are also presented in **Section 1. Hazardous Building Materials Register** of this Assessment report.

Asbestos-containing Materials (ACM)

- No clearance paperwork is known to exist for the removal of ACMs noted in the EBG report. As such, an assumption must be made that the asbestos-containing roof, gutters and flashing remain *in-situ* until such a time as a clearance certificate can be produced to show material has been removed as per current standards.
- ACM that may be disturbed should be removed prior to the commencement of any works.
- When asbestos removal works are required, the person that commissions the works must ensure that this is undertaken by an appropriately licensed asbestos contractor. The asbestos removal works must be conducted under controlled asbestos removal working conditions.
- When non-friable asbestos removal works are to be conducted within or adjacent to a highly sensitive area or public location, Prensa recommends that a hygienist who is independent of the asbestos contractor should be engaged to undertake airborne asbestos fibre monitoring along the boundary of the works and within the work area on completion of the works.
- A competent person or a licensed asbestos assessor must provide a Clearance Certificate that documents the visual clearance inspection and the satisfactory completion of the asbestos removal works. The Clearance Certificate should state that all visible asbestos dust and debris resulting from the asbestos removal process has been removed from the removal area(s) and from areas adjacent to the removal work area(s).
- Most ACM were found not to be appropriately labelled. ACM on-site should be labelled in accordance with the relevant state / territory Legislation and AS 1319-1994 *Safety signs for the occupational environment* to warn of the dangers of disturbing these materials.
- Schedule periodic reassessment of ACM remaining on-site to monitor their aging/deterioration so that the site controller can be alerted if any ACM require encapsulation or removal – in accordance with the relevant state / territory Legislation and Codes of Practice.
- A destructive hazardous building material survey should be carried out prior to any demolition or refurbishment works. Any hazardous building materials identified within this survey should be removed prior to the commencement of any works that may cause disturbance.
- During demolition/refurbishment works, if any materials that are not referenced in this report and are suspected of containing asbestos are encountered, then works must cease and an asbestos hygienist should be notified to determine whether the material contains asbestos.

Synthetic Mineral Fibre (SMF) Materials

- SMF materials that are likely to be disturbed during any proposed demolition/refurbishment works should be handled in accordance with the *Code of Practice for the Safe Use of Synthetic Mineral Fibres* [NOHSC:2006(1990)]. If these materials are impacted upon by accident or by pre-planned works, the Inner West Council must be informed via the contact detailed within Section 7: *Accidental Disturbance of Known or Suspected Hazardous Building Materials*. Following disturbance, inspection by a competent person should be undertaken.

Polychlorinated Biphenyls (PCB)

- Electrical fittings suspected of containing PCB oil capacitors should be treated as containing PCB oils until such time as evidence suggest otherwise e.g. further assessed.
- Electrical fittings that contain or suspected to contain PCB oil-containing capacitors should be removed as hazardous/regulated waste under controlled working conditions prior to the demolition or refurbishment works in accordance with the *Polychlorinated Biphenyls Management Plan, Revised Edition April 2003*.

Lead-containing Paint (LCP)

- The *LeadCheck* paint swab method can detect lead in paint at concentrations of 0.5% and above, and may indicate lead in some paint films as low as 0.2%. As paint with a lead content greater than 0.1% by dry weight is now considered to be lead-containing, Prensa recommends confirming status of suspected LCP identified during the Assessment by quantitative test method.
- The safest method of dealing with LCP is to replace or remove the items in their entirety that have LCP on them and replace them with new items that do not contain lead. This allows the items to be disposed of as regular building or demolition unsegregated waste in accordance with the NSW Environment Protection Authority (EPA) *Waste Classification Guidelines 2014 Part 1 – Classifying Waste*. The advantage of this method is the reduction in labour requirements to remove the lead paint and also this reduces the risk to workers from exposure to lead dust or fumes. If the removal of the LCP or coatings is the preferred or required option this may generate significant amounts of potential hazardous waste. This waste must be removed, collected and disposed of by an appropriately licensed contractor under controlled conditions that minimises the release to air, water and soil. Disposal of lead waste must be disposed of as hazardous waste at an approved waste facility.
- Advise all relevant site personnel and site contractors of the results of the LCP and the safe work procedures required and/or work practices to be avoided in the areas of confirmed LCP.
- Any remediation works that may generate dust or fumes (i.e. sanding, burning) must be performed under controlled conditions by a suitably resourced and experienced hazardous material/waste abatement contractor (e.g. a Class A licensed asbestos removal contractor).

Ozone Depleting Substances

- No recommendations.

Appendix A: Risk Assessment Factors and Priority Ratings

Risk Assessment Factors

To assess the health risk posed by the presence of hazardous building materials, all relevant factors must be considered. These factors include:

- Product type;
- Condition;
- Disturbance potential;
- Friability of the material;
- Proximity to direct air stream; and
- Surface treatment (if any).

The purpose of the material risk assessment is to establish the relative risk posed by specific hazardous building materials identified in this Assessment. The following risk factors are defined to assist in determining the relative health risk posed by each item.

Condition

The condition of the hazardous building materials identified during the Assessment is reported as being **good**, **fair** or **poor**.

- **Good** refers to a material that is in sound condition with no or very minor damage or deterioration.
- **Fair** refers to a material that is generally in a sound condition, with some areas of damage or deterioration.
- **Poor** refers to a material that is extensively damaged or deteriorated.

Friability

The friability of a material describes the ease by which the material can be crumbled, which in turn, can increase the release of fibres into the air. Therefore, friability is only applicable to asbestos and SMF.

- **Friable asbestos** can be crumbled, pulverised, or reduced to powder by hand pressure, which makes it more dangerous than non-friable asbestos.
- **Non-friable asbestos**, more commonly known as bonded asbestos, is typically comprised of asbestos fibres tightly bound in a non-asbestos matrix. If accidentally damaged or broken these ACMs may release fibres initially but will not continue to do so.
- **Bonded SMF** describes a synthetic fibrous material which has a specific designed shape and exists within a stable manufactured product.
- **Un-bonded SMF** is a loosely packed synthetic fibrous material which has no adhesive or cementitious binding properties.

Disturbance Potential

Hazardous building materials can be classified as having low, medium or high disturbance potential.

- **Low disturbance potential** describes materials that have very little or no activity in the immediate area with the potential to disturb the material. Low accessibility is considered as monthly occupancy or less, or inaccessible due to its height or its enclosure.
- **Medium disturbance potential** describes materials that have moderate activity in the immediate area with the potential to disturb the material. Medium accessibility is considered weekly access or occupancy.
- **High disturbance potential** describes materials that have regular activity in the immediate area with the potential to disturb the material.

Health Risk Status

The risk factors described above are used to grade the potential health risk ranking posed by the presence of the materials. These risk rankings are described below:

- A **low health risk** describes a material that poses a negligible or low health risk to occupants of the area due to the materials not readily releasing fibres (or other toxic/hazardous constituents) unless seriously disturbed.
- A **medium health risk** describes a material that pose a moderate health risk due to the material status and activity in the area.
- A **high health risk** describes a material that pose a high health risk to personnel or the public in the area of the material.

ACM Priority Rating System for Control Recommendations

While an assessment of health risk has been made, our recommendations have been prioritised based on the practicability of a required remedial action. In determining a suitable priority ranking, consideration has been given to the following:

- Level of health risk posed by the hazardous building material;
- Potential commercial implications of the finding; and
- Ease of remediation.

As a guide the recommendation priorities have been given a timeframe as follows:

Priority 1 (P1):	Asbestos Containing Material with High Risk Potential – Requiring immediate action
-------------------------	---

Status: ACM that are either damaged or are being exposed to continual disturbance. Due to these conditions there is an increased potential for exposure and/or transfer of the material to other parts of the property if unrestricted use of the area containing the material is allowed.

Recommendation: If the ACM is in a poor/unstable condition and accessible with risk to health from exposure, access restrictions to the immediate area should be applied, air monitoring should be considered and removal recommended as soon as practicable using an appropriately licensed removalist.

Priority 2 (P2):	Asbestos Containing Material with Medium Risk Potential – May require action in the short term
-------------------------	---

Status: ACM with a potential for disturbance due to the following conditions:

- Material has been disturbed or damaged and its current condition, while not posing an immediate risk, is unstable.
- The material is accessible and can, when disturbed, present a short-term exposure risk.
- The material could pose an exposure risk if workers are in close proximity.

Recommendation: If the ACM is easily accessible but in a stable condition, removal is preferred. However, if removal is not immediately practicable, short-term control measures (i.e. restrict access, sealing, enclosure etc) may be employed until removal can be facilitated as soon as is practical (3-6 months). Negligible health risk if material remains undisturbed under the control of a management plan.

Priority 3 (P3):	Asbestos Containing Material with Low Risk Potential – May require action
-------------------------	--

Status: ACM with a low potential for disturbance due to the following conditions:

- The material is in good condition but the surface of the material has been disturbed slightly or has deteriorated as a result of minor environmental factors. This may include influences such as weathering or if the material has sustained minor cracks or broken due to minimal damage.
- The material appears to be in good condition, however further disturbance or damage may occur which would increase the likelihood of asbestos fibres or other hazardous materials being released if disturbed.

Recommendation: Minor health risks if the ACM is left undisturbed under the control of a management plan. Consider removal or encapsulation of the materials.

Priority 4 (P4):	Asbestos Containing Material with Negligible (very low) Risk Potential
-------------------------	---

Status: The ACM is in a friable or non-friable form and in good condition. It is most unlikely that the material can be disturbed under normal circumstances. Even if it were subjected to minor disturbance the material poses a minor health risk.

Recommendation: These ACM's should be left in a good and stable condition, with ongoing maintenance and periodic inspection. It is advisable that any remaining identified building materials or presumptions should be appropriately labelled, where possible, and regularly inspected to ensure they are not deteriorating resulting in a potential risk to health.

OHM Action:	Other Hazardous Building Materials with a Requirement for Short Term Remediation
--------------------	---

Status: The hazardous material is damaged or in a degraded condition. The material may be disturbed under normal circumstances. If it were subjected to disturbance the material potentially poses a health risk to personnel.

Recommendation: The building material should be removed or remediated in the short-term to control potential occupant exposure. This should be undertaken in accordance with guidelines defined under **Section 8** of this report.

Appendix B: Areas Not Accessed

Given the constraints of practicable access encountered during this Assessment, the following areas were not inspected. Assessments are restricted to those areas that are reasonably accessible at the time of the Assessment with respect to the following:

- Without contravention of relevant statutory requirements or codes of practice.
- Without placing the Prensa consultant and/or others at undue risk.
- Without demolition or damage to finishes and structure.
- Excluding plant and equipment that was 'in service' and operational.

Documented below are the areas where the Prensa consultant encountered access restrictions during the Assessment:

Areas Not Accessed

Limited access to roof space due to limited access hatches at the time of the Assessment.

Underneath the concrete slab of all building structures at the site.

Exposed soils surrounding the building structures of the site.

Energised services, gas, electrical, pressurised vessel and chemical lines.

Height restricted areas above 2.7m or any area deemed inaccessible without the use of specialised access equipment.

Within cavities that cannot be accessed by the means of a manhole or inspection hatch.

Within voids or internal areas of plant, equipment, air-conditioning ducts etc.

Within service shafts, ducts etc., concealed within the building structure.

Within those areas accessible only by dismantling equipment.

Within totally inaccessible areas such as voids and cavities present but intimately concealed within the building structure.

All areas outside the Scope of Work.

Note:

If proposed works entail possible disturbance of any suspect materials in the above locations, or any other location not mentioned in **Section 1. Hazardous Building Materials Register**, further investigation may be required prior to the commencement of such works.

The presence of residual asbestos insulation on steel members, concrete surfaces, pipe work, equipment and adjacent areas remaining from prior removal works cannot normally be determined without extensive removal and damage to existing insulation, fixtures and fittings at the Site. If, during any demolition/refurbishment works any materials that are not referenced in this report and are suspected of containing asbestos are encountered, works must cease and a hygienist should be notified to determine whether the material is hazardous.

Appendix C: NATA Endorsed Laboratory Sample Analysis Report

5 February 2018

Rick Jarvis
Inner West Council
7-15 Wetherill Street
Leichhardt NSW 2040

Dear Rick,

Asbestos Bulk Sample Analysis Report Cecily Street Community Centre

Please find attached the asbestos bulk sample analysis results of the 8 samples collected by Ellen Hibbert of Prensa Pty Ltd for Cecily Street Community Centre on 2 February 2018 and received at the Prensa Pty Ltd laboratory (Level 2, 115 Military Road, Neutral Bay NSW 2089) on 2 February 2018. The samples were analysed on 5 February 2018 and the results are presented on the following page(s).

Prensa qualitatively analyses bulk samples for asbestos using polarising light microscopy and dispersion staining techniques in accordance with Prensa's National Association of Testing Authorities (NATA), Australia approved PRLAB2002 Asbestos Identification Test Method, and in accordance with Australian Standard (AS) 4964 – 2004, *Method for the qualitative identification of asbestos in bulk samples* and AS ISO/IEC 17025 – 2005, *General requirements for the competence of testing and calibration laboratories*.

If you require further information please contact the Prensa office on (02) 8968 2500.

Regards,



Patricy Cortes

Approved Asbestos Fibre Identifier and Signatory



Accredited for compliance with ISO/IEC 17025 - Testing. Corporate Site Number 21837. This document shall not be reproduced except in full. Sampling is not covered by the scope of the NATA accreditation.

Asbestos Bulk Sample Analysis Report Cecily Street Community Centre

Sample No	Sample Location / Description / Size	Result
57722 - 027 - 001	Exterior, north corner, eaves - fibre cement sheeting White painted beige fibre cement material ~ 8 x 7 x 1 mm	No asbestos fibres detected Organic fibres detected
57722 - 027 - 002	Northern store room, throughout, wall lining - fibre cement sheeting Unpainted beige fibre cement material ~ 5 x 4 x 1 mm	No asbestos fibres detected Organic fibres detected
57722 - 027 - 003A	Meeting room, light blue/green floor covering, throughout - sheet vinyl Light blue semi flexible vinyl material ~ 25 x 10 x 2 mm	No asbestos fibres detected
57722 - 027 - 003B	Meeting room, light blue/green floor covering, throughout - sheet vinyl Amber adhesive attached to 57722-001-003A ~ 25 x 10 x <1 mm	No asbestos fibres detected
57722 - 027 - 004	Quiet room, southern wall lining - fibre cement sheeting White painted beige fibre cement material ~ 10 x 8 x 1 mm	No asbestos fibres detected Organic fibres detected
57722 - 027 - 005A	Quiet room, red floor coverings - sheet vinyl Red semi flexible vinyl material ~ 40 x 19 x 2 mm	No asbestos fibres detected
57722 - 027 - 005B	Quiet room, red floor coverings - sheet vinyl Grey adhesive attached to 57722-001-005A ~ 40 x 19 x <1 mm	No asbestos fibres detected
57722 - 027 - 006A	Hall, stage floor covering - cream sheet vinyl Cream semi flexible vinyl material ~ 27 x 18 x 2 mm	No asbestos fibres detected
57722 - 027 - 006B	Hall, stage floor covering - cream sheet vinyl Grey adhesive attached to 57722-001-006A ~ 27 x 18 x <1 mm	No asbestos fibres detected
57722 - 027 - 007	Hall, eastern and northeast wall lining - textured coating White textured coating material ~ 18 x 9 x 4 mm	No asbestos fibres detected
57722 - 027 - 008A	Western store room, blue floor covering - sheet vinyl Blue semi flexible vinyl material ~ 22 x 11 x 2 mm	No asbestos fibres detected
57722 - 027 - 008B	Western store room, blue floor covering - sheet vinyl Grey adhesive attached to 57722-001-008A ~ 22 x 11 x <1 mm	No asbestos fibres detected

Only the samples submitted for analysis have been considered in presenting these results.

APPENDIX A: ASBESTOS ANALYSIS REPORT

DATE: April 22, 2010
 CLIENT: Leichhardt Council
 JOB No: 01998
 SAMPLES FROM: Lilyfield Community Centre
 COLLECTED BY: Michael Edwards

Sample #	Location of Sample	Material	Analysis Result
01998/1	Wall - main auditorium road side	Textured paint	No asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/2	Kitchen floor	Red vinyl sheet	No asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/3	Ext. covered way – wall to toy cupboard	Fibreboard	No asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/4	Roof	Super 6 corrugated sheeting	Chrysotile asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/5	Flashing facing laneway	Moulded fibre cement	Chrysotile asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/6	Downpipes – road side	Moulded fibre cement	Chrysotile asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/7	Debris in gutter (residence side)	Debris (grass, dirt)	Chrysotile asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining
01998/8	Electrical box – fibreboard electrical dist. board	Moulded fibreboard	Chrysotile asbestos was detected by stereobinocular and polarising light microscopy (PLM) including Dispersion Staining

Crocidolite - Blue asbestos, Chrysotile - White asbestos, Amosite - Brown asbestos, SMF - Synthetic Mineral Fibre

TEST METHOD: Samples have been examined in accordance with the 1991 NATA Guidance Notes on Asbestos Identification and the EBG Identification of Asbestos in Bulk Materials

IDENTIFICATION TECHNIQUE: Sample has been analysed using stereobinocular and polarising light microscopy (PLM) including Dispersion Staining, except where stated.

Analysed By:

Michael Edwards (BSc MAppSc)
 Env. Science / Occup. Hygiene

Appendix D: Statement of Limitations

Statement of Limitations

This document has been prepared in response to specific instructions from IWC to whom the report has been addressed. The work has been undertaken with the usual care and thoroughness of the consulting profession. The work is based on generally accepted standards and practices of the time the work was undertaken. No other warranty, expressed or implied, is made as to the professional advice included in this report.

The report has been prepared for the use by IWC and the use of this report by other parties may lead to misinterpretation of the issues contained in this report. To avoid misuse of this report, Prensa advises that the report should only be relied upon by IWC and those parties expressly referred to in the introduction of the report. The report should not be separated or reproduced in part and Prensa should be retained to assist other professionals who may be affected by the issues addressed in this report to ensure the report is not misused in any way.

Unless otherwise stated in this report, the scope is limited to fixed and installed materials and excludes buried waste materials, contaminated dusts and soils.

Unless expressly stated it is not intended that this report be used for the purposes of tendering works. Where this is the intention of IWC, this intention needs to be communicated with Prensa and included in the scope of the Proposal.

Prensa is not a professional quantity surveyor (QS) organisation. Any areas, volumes, tonnages or any other quantities noted in this report are indicative estimates only. The services of a professional QS organisation should be engaged if quantities are to be relied upon.

Sampling Risks

It is noted that while the Assessment has attempted to locate the asbestos-containing materials within the building(s), the investigation was limited to only a visual Assessment and limited sampling program and/or the review and analysis of previous reports made available. Prensa notes that sampling is representative only and that due to the lack of homogeneity of building materials it is possible that sampling has not detected all asbestos within the nominated locations.

Given that a representative sampling program has been adopted, not all materials suspected of containing asbestos at the time of the investigation were sampled and assessed. It is noted that some asbestos materials may have been assumed to contain asbestos based on their similar appearance to previously sampled materials.

Therefore, it is possible that asbestos materials, which may be concealed within inaccessible areas/voids, may not have been located during the investigation. Such areas include, but are not limited to:

- Materials concealed behind structural members and within inaccessible building voids;
- Areas inaccessible without the aid of scaffolding or lifting devices;
- Areas below ground;
- Inaccessible ceiling or wall cavities;
- Areas which require substantial demolition to access;
- Areas beneath floor covering where asbestos-containing materials were not expected to exist;
- Materials contained within plant and not accessible without dismantling the plant; and
- Areas where access is restricted due to locked doors, safety risks, or being occupied at the time of the investigation.

Reliance on Information Provided by Others

Prensa notes that where information has been provided by other parties in order for the works to be undertaken, Prensa cannot guarantee the accuracy or completeness of this information. IWC therefore waives any claim against the company and agrees to indemnify Prensa for any loss, claim or liability arising from inaccuracies or omissions in information provided to Prensa by third parties. No indications were found during our investigations that information contained in this report, as provided to Prensa, is false.

Future Works

During future works at the site, care should be taken when entering or working in any previously inaccessible areas or areas mentioned above and it is imperative that works cease immediately pending further investigation and sampling (if necessary) if any unknown materials are encountered. Therefore, during any refurbishment or demolition works, further investigation, sampling and/or Assessment may be required should any suspect or unknown material be observed in previously inaccessible areas or areas not fully inspected, i.e. carpeted floors.